

Real-Time Water Quality Report

Leary's Brook at Prince Philip Drive

Deployment Period
November 20, 2015 to December 17, 2015



Government of Newfoundland & Labrador
Department of Environment and Conservation
Water Resources Management Division

Prepared by:

Paul Rideout
Environmental Scientist
Water Resources Management Division
Department of Environment & Conservation
4th Floor, Confederation Building, West Block
PO Box 8700, St. John's NL A1B 4J6
Ph. No.: (709) 729 - 0351
Fax No.: (709) 729 - 0320
paulrideout@gov.nl.ca

General

- The Water Resources Management Division (WRMD), in partnership with Environment Canada, maintain a real-time water quality and water quantity monitoring station at Leary's Brook adjacent to Prince Phillip Parkway.
- The real-time station allows for assessment and management of the water body. This deployment report discusses water quality related events occurring at the Leary's Brook station.
- The purpose of this real-time station is to monitor, process and publish hydrometric (water quantity) and real-time water quality data at the real-time station. Leary's Brook is an urban stream that flows through industrial and commercial areas and adjacent to a major roadway.
- This report covers the period between the deployment on November 20, 2015 and removal on December 17, 2015.

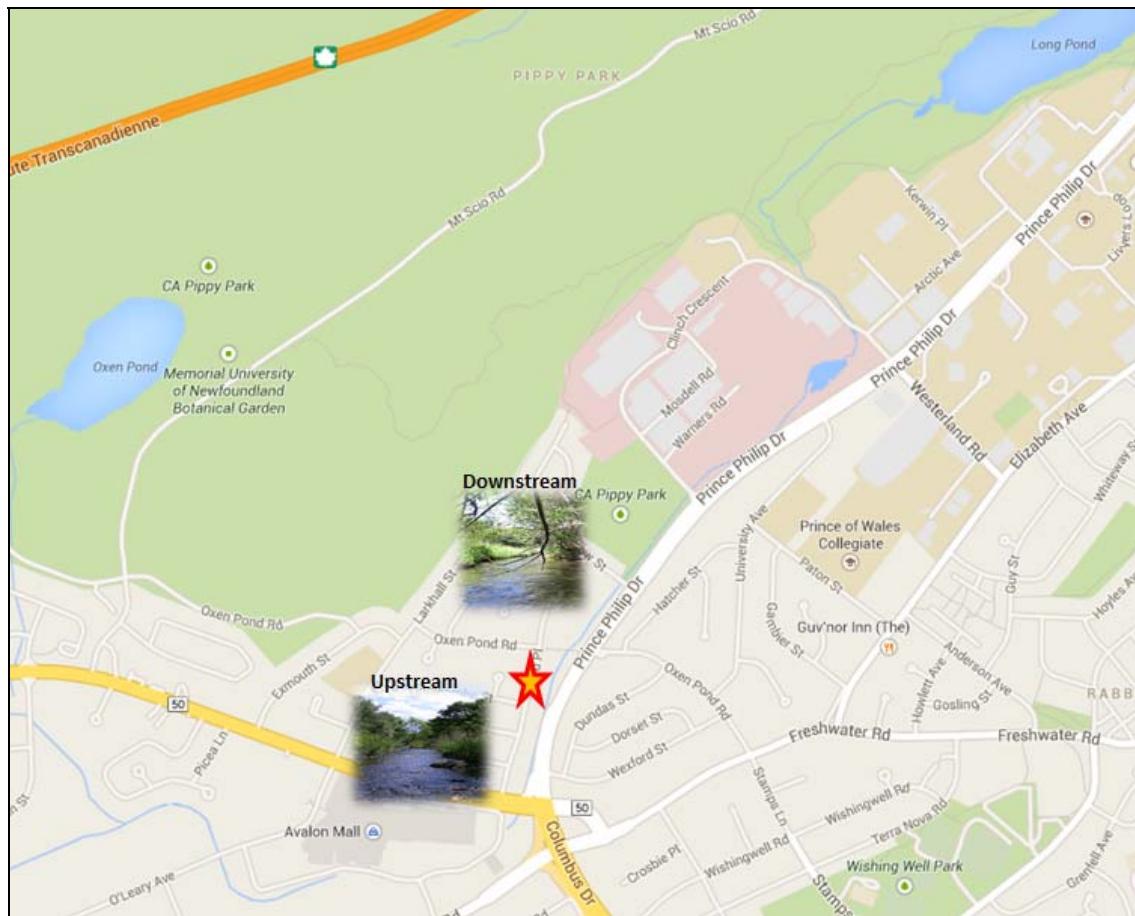


Figure 1: Leary's Brook Real-Time Water Quality and Quantity Station.

Quality Assurance and Quality Control

- As part of the Quality Assurance and Quality Control protocol (QA/QC), an assessment of the reliability of data recorded by an instrument is made at the beginning and end of the deployment period. The procedure is based on the approach used by the United States Geological Survey.
- At deployment and removal, a QA/QC Sonde is temporarily deployed alongside the Field Sonde. Values for temperature, pH, conductivity, dissolved oxygen and turbidity are compared between the two instruments. Based on the degree of difference between the parameters on the Field Sonde and QA/QC Sonde at deployment and at removal, a qualitative statement is made on the data quality (Table 1).

Table 1: Instrument Performance Ranking classifications for deployment and removal

Parameter	Rank				
	Excellent	Good	Fair	Marginal	Poor
Temperature (°C)	<=+-0.2	>+-0.2 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	<+-1
pH (unit)	<=+-0.2	>+-0.2 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	>+-1
Sp. Conductance ($\mu\text{S}/\text{cm}$)	<=+-3	>+-3 to 10	>+-10 to 15	>+-15 to 20	>+-20
Sp. Conductance > 35 $\mu\text{S}/\text{cm}$ (%)	<=+-3	>+-3 to 10	>+-10 to 15	>+-15 to 20	>+-20
Dissolved Oxygen (mg/L) (% Sat)	<=+-0.3	>+-0.3 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	>+-1
Turbidity <40 NTU (NTU)	<=+-2	>+-2 to 5	>+-5 to 8	>+-8 to 10	>+-10
Turbidity > 40 NTU (%)	<=+-5	>+-5 to 10	>+-10 to 15	>+-15 to 20	>+-20

- The temperature sensor on any sonde is the most important. All other parameters can be divided into subgroups of: temperature dependant, temperature compensated and temperature independent. Due to the temperature sensor's location on the sonde, the entire sonde must be at a constant temperature before the temperature sensor will stabilize. The values may take some time to climb to the appropriate reading; if a reading is taken too soon it may not accurately portray the water body.
- Deployment and removal instrument performance rankings for **Leary's Brook** for the period of November 20, 2015 to December 17, 2015 are summarized in Table 2.

Table 2: Instrument performance rankings for Leary's Brook

Station	Date	Action	Comparison Ranking				
			Temperature	pH	Conductivity	Dissolved Oxygen	Turbidity
Leary's Brook	November 20 2015	Deployment	Excellent	Good	Good	Excellent	Excellent
	December 17 2015	Removal	Excellent	Good	Fair	Marginal	Excellent

- At the Leary's Brook station at the time of deployment, the temperature, dissolved oxygen and turbidity data all ranked as 'Excellent'. The pH and conductivity data ranked as "Good."
- At the time of removal, temperature and turbidity ranked as "Excellent", pH ranked as "Good", conductivity ranked as "Fair", and dissolved oxygen ranked as 'Marginal'. The rankings at removal may have been influenced by the presence of the biofouling growth/debris caught within the sensors on the instrument. There was a significant amount of sand debris captured inside the protective cap on the sonde.

Data Interpretation

- The following graphs and discussion illustrate water quality-related events from November 20, 2015 to December 17, 2015 at the Leary's Brook station.
- With the exception of water quantity data (stage), all data used in the preparation of the graphs and subsequent discussion below adhere to this stringent QA/QC protocol. Water Survey of Canada is responsible for QA/QC of water quantity data. Corrected and finalized data may be retrieved from the Water Survey of Canada website (<http://www.ec.gc.ca/rhc-wsc/>)
- Precipitation data from the deployment period was retrieved from the Environment Canada weather station at St. John's International Airport.

Leary's Brook

Water Temperature

- Water temperature ranged from -0.02°C to 7.46°C during this deployment period (Figure 2).
- Water temperature at Leary's Brook displays a typical variation in pattern over the deployment period. Water temperature is influenced by air temperature.
- The water temperature data displayed on Figure 2 is typical of shallow streams and ponds. Shallow water bodies are highly influenced by variations in ambient air temperatures. Water temperature falls overnight and rises during daylight hours.

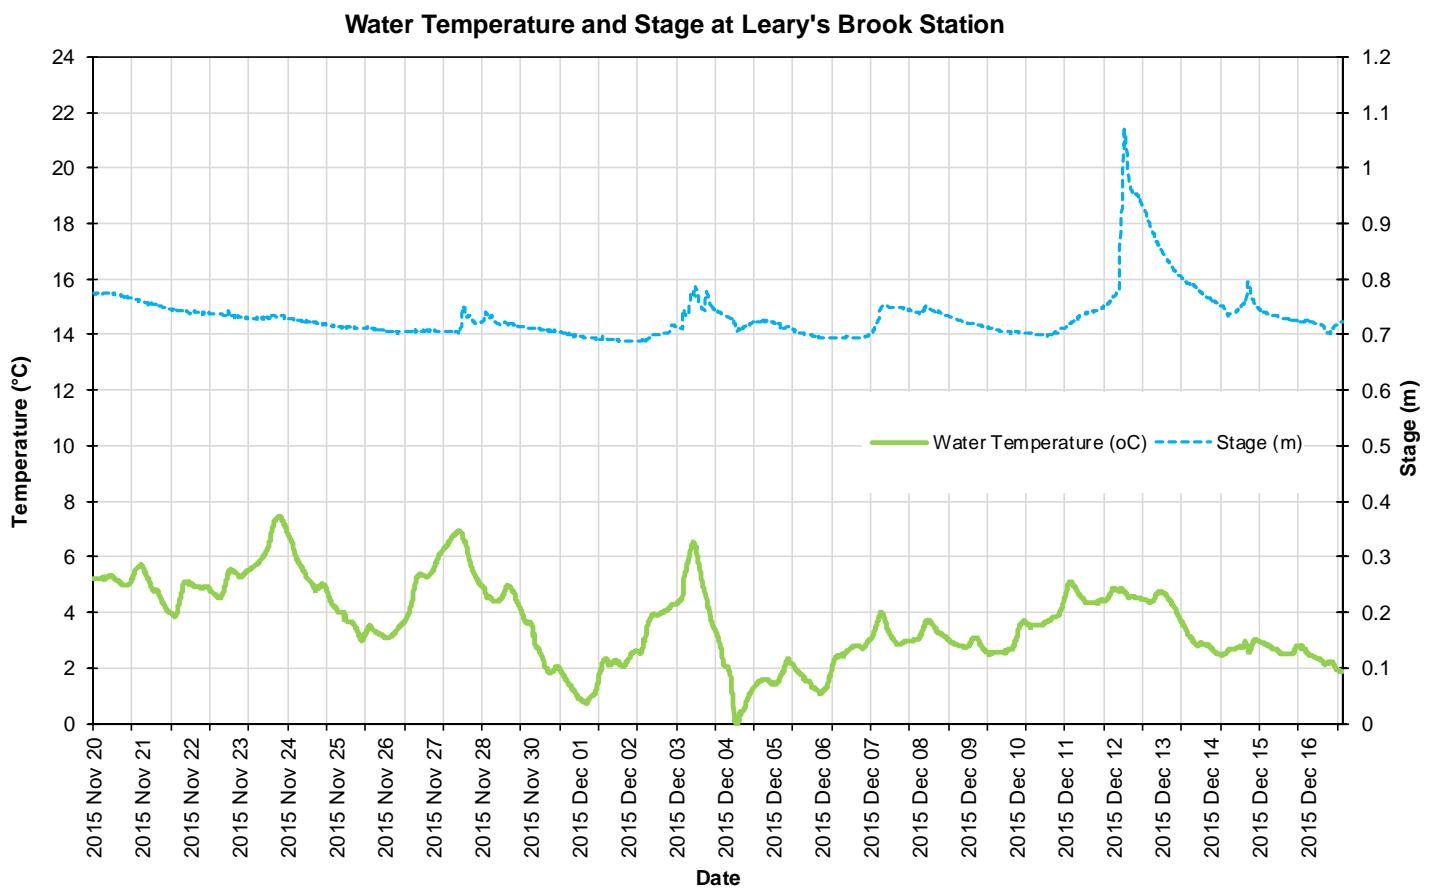


Figure 2: Water temperature ($^{\circ}\text{C}$) values at Leary's Brook

pH

- Throughout this deployment period pH values ranged between 6.53 pH units and 6.86 pH units (Figure 3).
- During the deployment, pH values were consistently near or above the minimum CCME Guidelines for the Protection of Aquatic Life (6.5 pH units).
- The CCME guideline provides a basis by which to judge the overall health of the brook. Naturally, all streams and brooks are different. Leary's Brook pH median was 6.71 (pH units) for this deployment period.

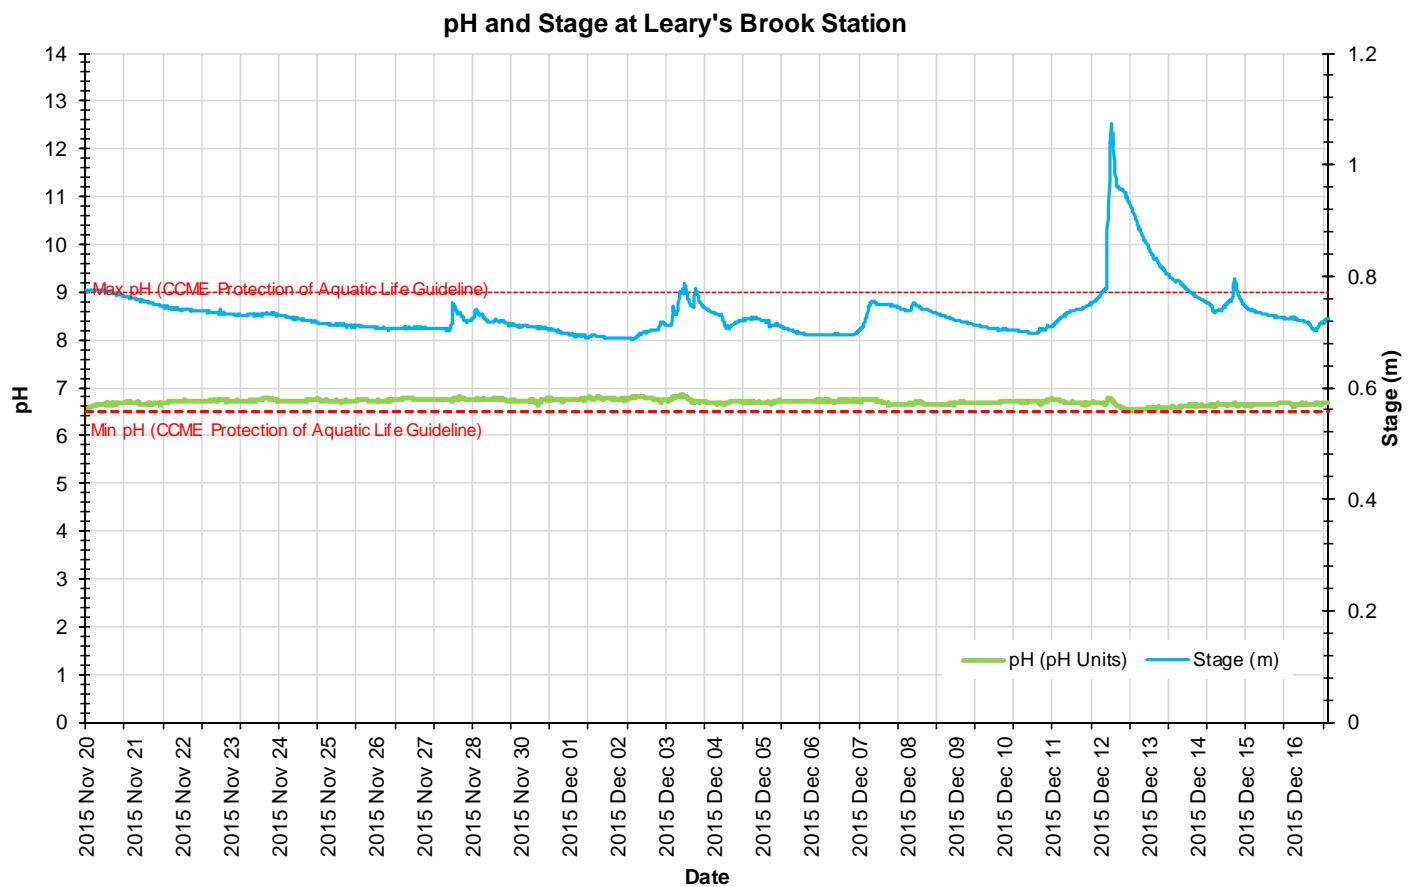


Figure 3: pH (pH units) values at Leary's Brook Station

Specific Conductivity

- The conductivity levels ranged between 426.0 $\mu\text{S}/\text{cm}$ and 4696.0 $\mu\text{S}/\text{cm}$ during this deployment period. The median was 719.0 $\mu\text{S}/\text{cm}$. TDS ranged from 0.2720 g/ml to 3.0100 g/ml.
- This was a relatively dry period with very little fluctuation in flow in Leary's Brook. Peaks in conductivity are believed to be associated with road/parking lot salting adjacent and upstream of Leary's Brook due to low temperatures encountered nightly.

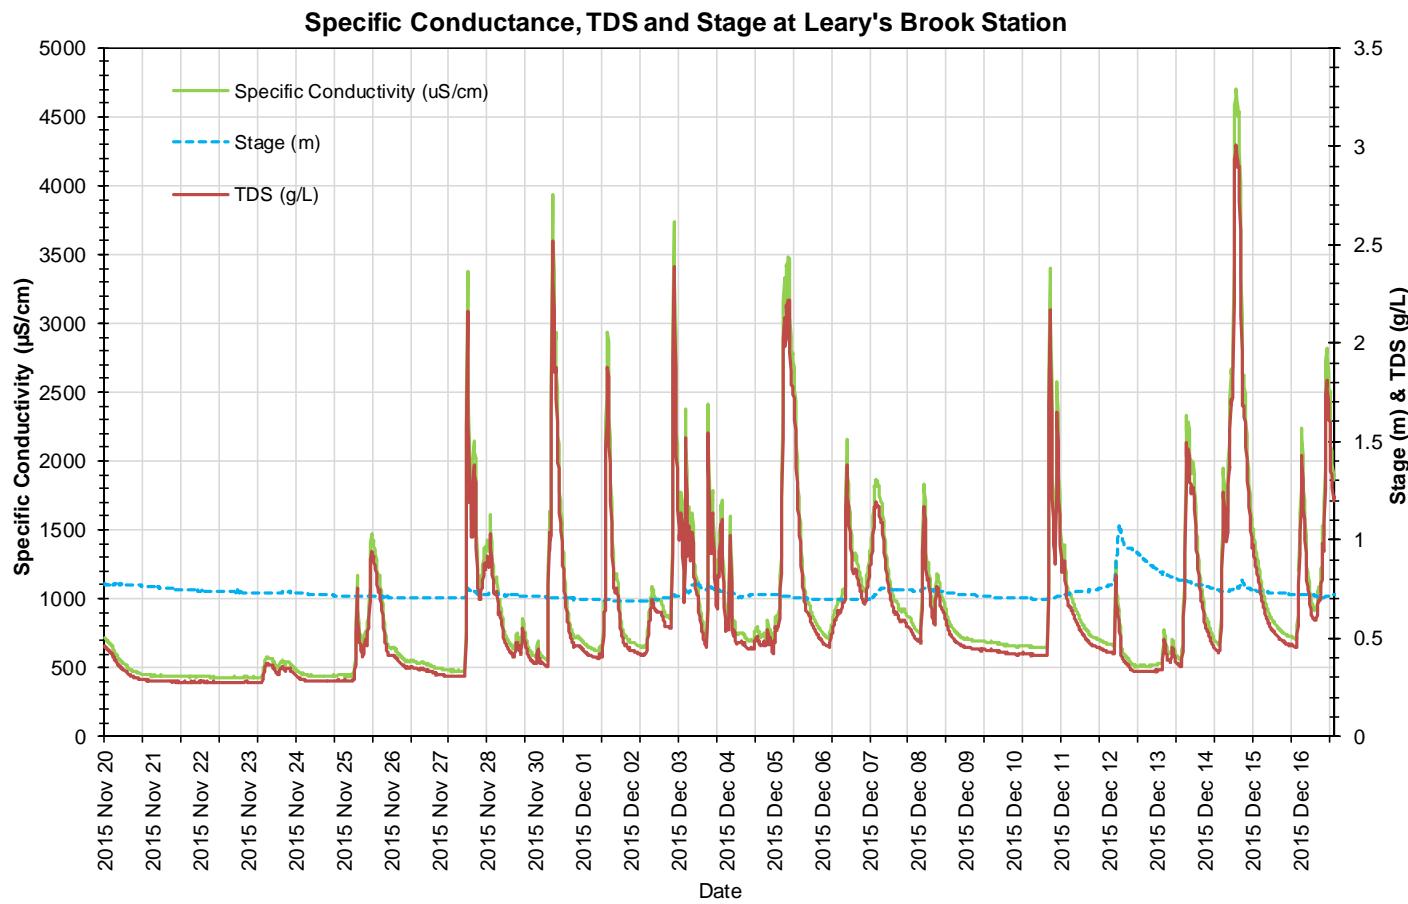


Figure 4: Specific conductivity ($\mu\text{S}/\text{cm}$), TDS (g/L) and stage (m) values at Leary's Brook Station

Dissolved Oxygen

- The instrument measures dissolved oxygen (mg/L) directly then calculates percent saturation (% Sat.).
- The Dissolved Oxygen % Sat levels within this deployment period were between 94.5% Sat and 101.1% Sat. Dissolved Oxygen (mg/L) measured between 11.37 mg/L and 13.83 mg/L.
- The DO mg/L values are consistently above the minimum DO CCME guideline for early life stages for this deployment period (Figure 5).
- Dips in mg/L values are associated with increases in water temperatures. Cool water can hold more dissolved oxygen than warmer water.

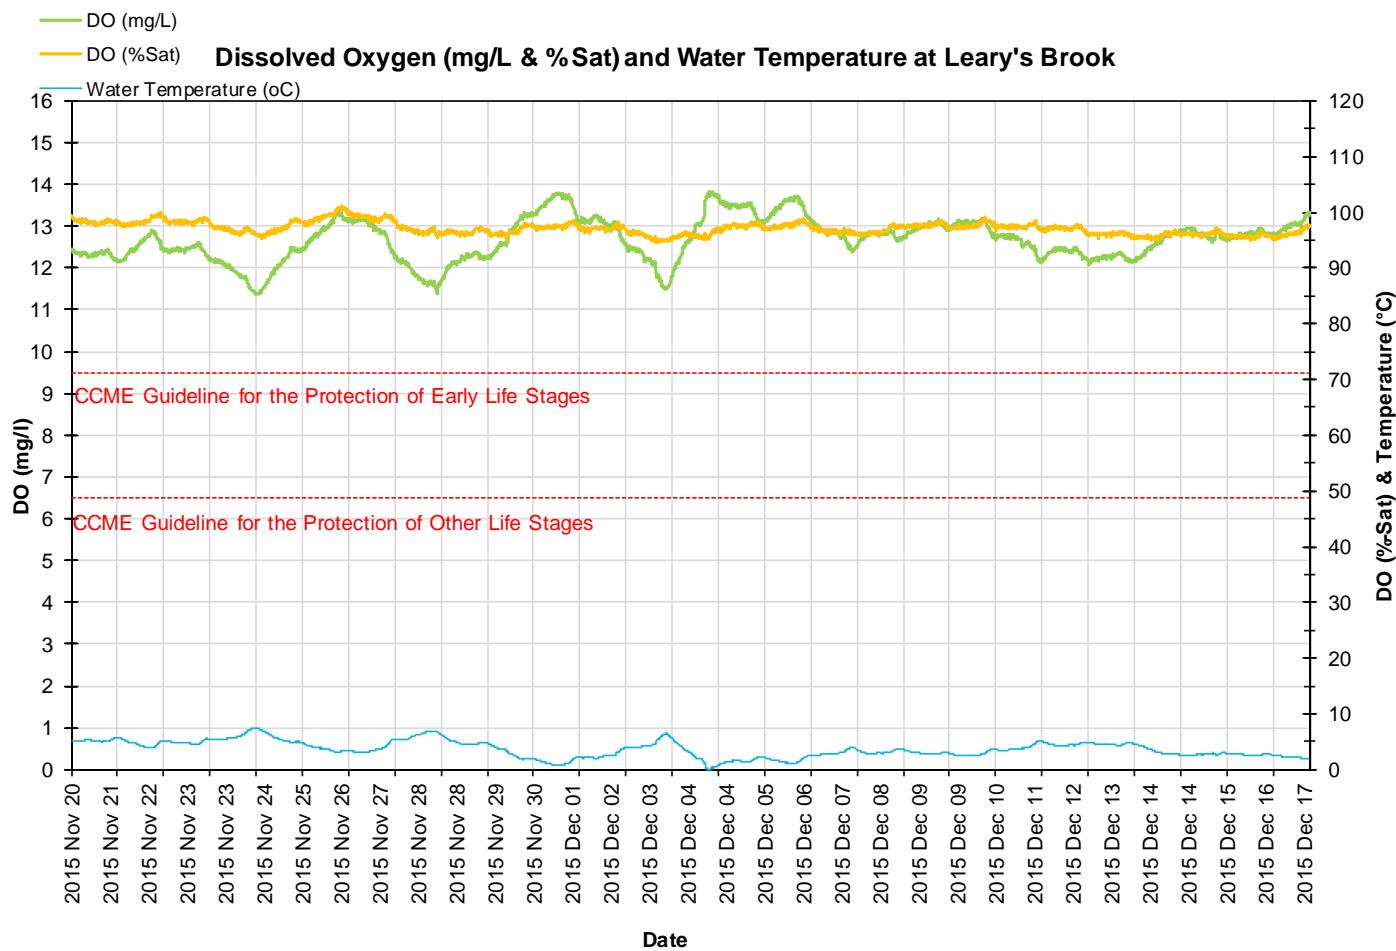


Figure 5: Dissolved oxygen (mg/L & % sat) and water temperature (°C) values at Leary's Brook Station

Turbidity

- The turbidity sensor records values between 0 NTU and 3000 NTU. A turbidity reading of 3000NTU is identified as an error and is not a true value. Readings of 3000 NTU should not be included in any statistical analysis.
- The turbidity readings during this deployment ranged within 1.3 NTU to 648.0 NTU (Figure 6).
- Higher turbidity values closely correspond with precipitation events and elevated river stage and runoff (Figure 7). Rainfall and subsequent runoff along with increased flow carries road and bank sediment and other material into the brook which is captured by the turbidity sensor.

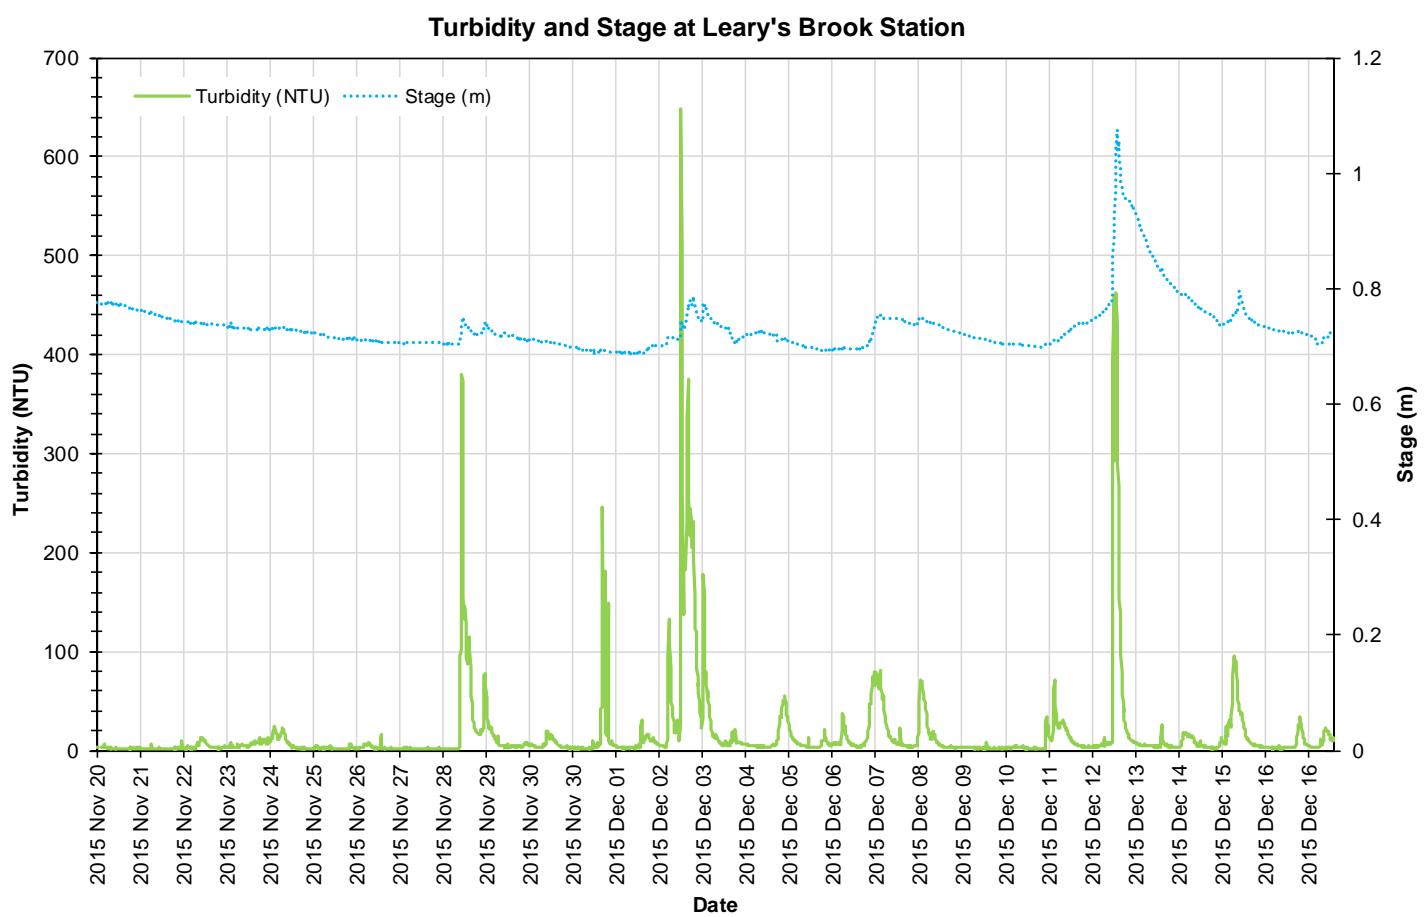


Figure 6: Turbidity (NTU) values at Leary's Brook Station

Stage and Total Precipitation

- The below graph includes daily total precipitation data from St. John's International Airport weather station and the daily average stage. Please note that the stage data in this report is raw data. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.
- Stage (and streamflow) usually varies significantly throughout the deployment period in Leary's Brook. During this deployment period, weather was relatively dry and stage (and streamflow) showed little variation (Figure 7). Stage is directly influenced by rainfall and subsequent runoff from the surrounding environment. Precipitation runoff impacts urban streams relatively quickly as rainfall flows across impervious surfaces such as roads and parking lots and then into storm drains.

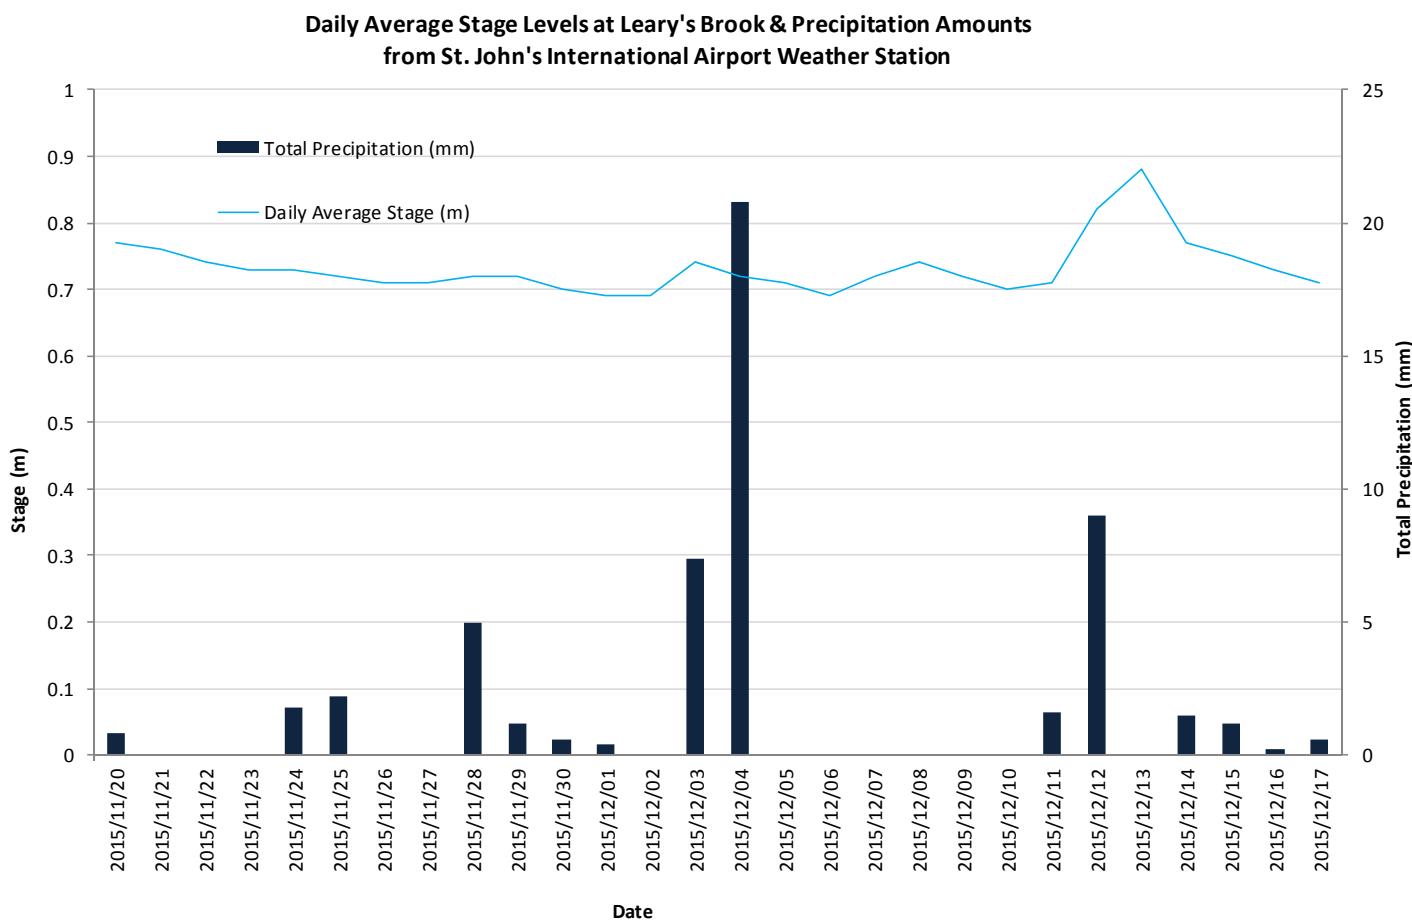


Figure 7: Daily average stage values (m) from Leary's Brook Station and daily total precipitation values (mm) from St. John's International Airport.

Conclusions

Generally in natural environments, climate and weather conditions contribute in large part to the variation in water quality. During this deployment it was evident that many of the changes displayed on the graphs are related to intermittent precipitation events and small climatic changes of the seasons. The impact of road salting was also seen during this deployment period.

Precipitation events and road salting during the deployment period led to related fluctuations in stage, which thus influenced the values of turbidity, pH, specific conductance, and TDS. When ambient air temperatures decreased, there were correspondingly cooler water temperatures, which in turn slightly increased the amount of dissolved oxygen in the water.

During this deployment period the median water temperature at the Leary's Brook station was 3.55°C.

The median pH value for Leary's Brook Station was 6.71 (pH units). The pH level for the most part is steady at this station.

Dissolved Oxygen at Leary's Brook had a median of 97.1 %Sat during the deployment period. The small increases in DO (mg/L and % Sat) correspond with decreases in water temperatures.

The turbidity median value at Leary's Brook during deployment was 4.4 NTU. Increases in stage level can explain most of the peaks in the turbidity values during the deployment period. As organic matter and sediments are washed into the brook, the suspended matter in the water column will increase and the turbidity sensor will detect an increase in water cloudiness.