

Real-Time Water Quality Report

Leary's Brook at Prince Philip Drive

Deployment Period
May 17, 2017 to June 30, 2017



Government of Newfoundland & Labrador
Department of Municipal Affairs and Environment
Water Resources Management Division

Leary's Brook, Newfoundland and Labrador

Prepared by:

Paul Rideout
Environmental Scientist
Water Resources Management Division
Department of Municipal Affairs and Environment
4th Floor, Confederation Building, West Block
PO Box 8700, St. John's NL A1B 4J6
Ph. No.: (709) 729 - 0351
Fax No.: (709) 729 - 0320
paulrideout@gov.nl.ca

General

- The Water Resources Management Division (WRMD), in partnership with Environment and Climate Change Canada (ECCC), maintains a real-time water quality and water quantity monitoring station at Leary's Brook adjacent to Prince Phillip Parkway.
- The real-time station allows for assessment and management of the water body. This deployment report discusses water quality related events occurring at the Leary's Brook station.
- The purpose of this real-time station is to monitor, process and publish hydrometric (water quantity) and real-time water quality data at the real-time station. Leary's Brook is an urban stream that flows through industrial and commercial areas and adjacent to a major roadway.
- This report covers the period between the deployment on May 17, 2017 and removal on June 30, 2017.

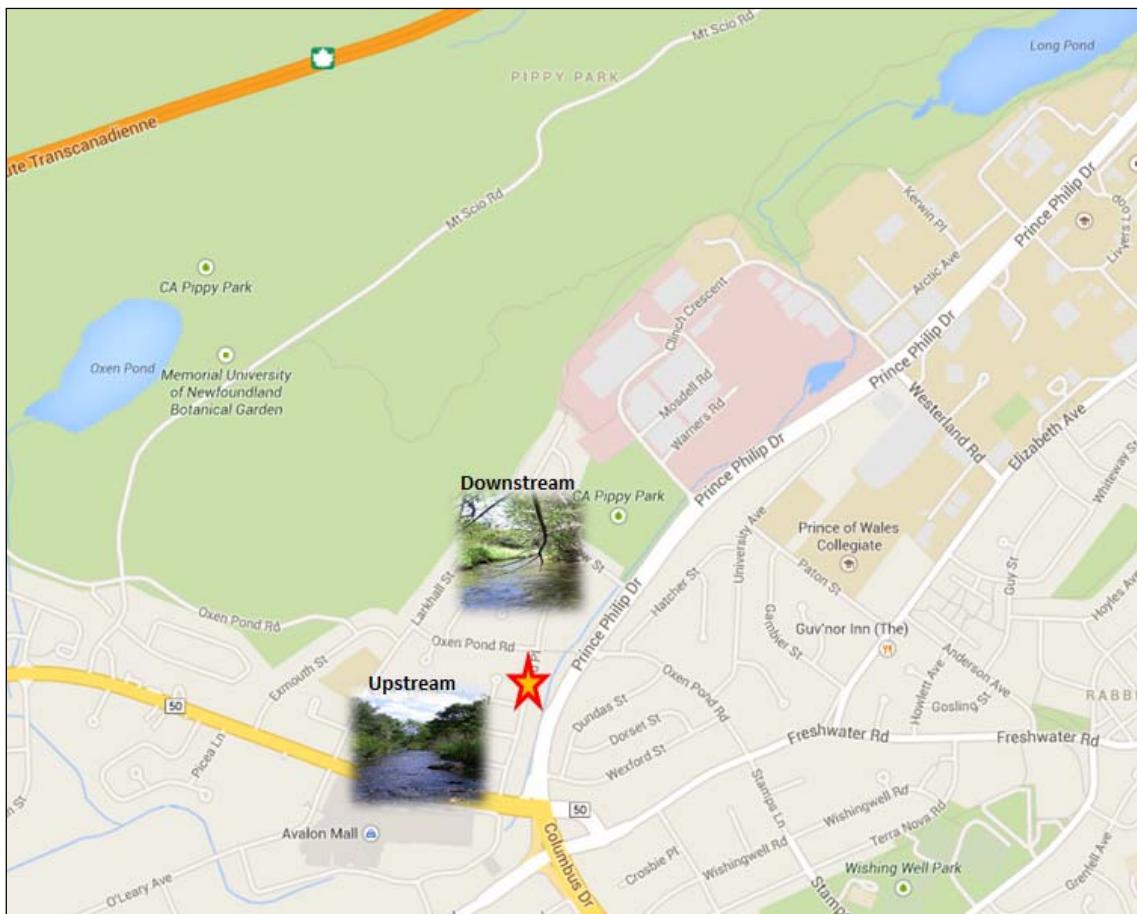


Figure 1: Leary's Brook Real-Time Water Quality and Quantity Station.

Quality Assurance and Quality Control

- As part of the Quality Assurance and Quality Control protocol (QA/QC), an assessment of the reliability of data recorded by an instrument is made at the beginning and end of the deployment period. The procedure is based on the approach used by the United States Geological Survey.
- At deployment and removal, a QA/QC Sonde is temporarily deployed alongside the Field Sonde. Values for temperature, pH, conductivity, dissolved oxygen and turbidity are compared between the two instruments. Based on the degree of difference between the parameters on the Field Sonde and QA/QC Sonde at deployment and at removal, a qualitative statement is made on the data quality (Table 1).

Table 1: Instrument Performance Ranking classifications for deployment and removal

Parameter	Rank				
	Excellent	Good	Fair	Marginal	Poor
Temperature (°C)	<=+-0.2	>+-0.2 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	<+-1
pH (unit)	<=+-0.2	>+-0.2 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	>+-1
Sp. Conductance ($\mu\text{S}/\text{cm}$)	<=+-3	>+-3 to 10	>+-10 to 15	>+-15 to 20	>+-20
Sp. Conductance > 35 $\mu\text{S}/\text{cm}$ (%)	<=+-3	>+-3 to 10	>+-10 to 15	>+-15 to 20	>+-20
Dissolved Oxygen (mg/L) (% Sat)	<=+-0.3	>+-0.3 to 0.5	>+-0.5 to 0.8	>+-0.8 to 1	>+-1
Turbidity <40 NTU (NTU)	<=+-2	>+-2 to 5	>+-5 to 8	>+-8 to 10	>+-10
Turbidity > 40 NTU (%)	<=+-5	>+-5 to 10	>+-10 to 15	>+-15 to 20	>+-20

- The temperature sensor on any sonde is the most important. All other parameters can be divided into subgroups of: temperature dependent, temperature compensated and temperature independent. Due to the temperature sensor's location on the sonde, the entire sonde must be at a constant temperature before the temperature sensor will stabilize. The values may take some time to climb to the appropriate reading; if a reading is taken too soon it may not accurately portray the water body.
- Deployment and removal instrument performance rankings for **Leary's Brook** for the period of May 17 2017 to June 30, 2017 are summarized in Table 2.

Table 2: Instrument performance rankings for Leary's Brook

Station	Date	Action	Comparison Ranking				
			Temperature	pH	Conductivity	Dissolved Oxygen	Turbidity
Leary's Brook	May 17, 2017	Deployment	Good	Excellent	Excellent	Good	Good
	June 30, 2017	Removal	Good	Good	Good	Excellent	Good

- At the Leary's Brook station at the time of deployment, temperature, dissolved oxygen and turbidity readings ranked as "Good", while pH and conductivity ranked as "Excellent".

- At the time of removal, temperature, pH, conductivity and turbidity ranked as “Good” and dissolved oxygen readings ranked as “Fair”.

Data Interpretation

- The following graphs and discussion illustrate water quality-related events from May 17, 2017 to June 30, 2017 at the Leary's Brook station.
- With the exception of water quantity data (stage), all data used in the preparation of the graphs and subsequent discussion below adhere to this stringent QA/QC protocol. Water Survey of Canada (WSC) is responsible for QA/QC of water quantity data. Corrected and finalized data may be retrieved from the WSC website (<http://www.ec.gc.ca/rhc-wsc/>)
- Precipitation data from the deployment period was retrieved from the ECCC weather station at St. John's International Airport.
- A very large number of interruptions in data transmission occurred during this deployment period, likely the result of transmission equipment failures.
- The graphs below, except where noted, are based on data that was automatically recorded and logged by the water quality sonde on an hourly basis.

Leary's Brook

Water Temperature

- Water temperature ranged from 3.71 °C to 21.01 °C during this deployment period (Figure 2).
- Water temperature at Leary's Brook displays a typical variation over the deployment period. Water temperature is influenced by air temperature.
- The water temperature data displayed on Figure 2 is typical of shallow streams and ponds. Shallow water bodies are highly influenced by variations in ambient air temperatures. Water temperature also falls overnight and rises during daylight hours.

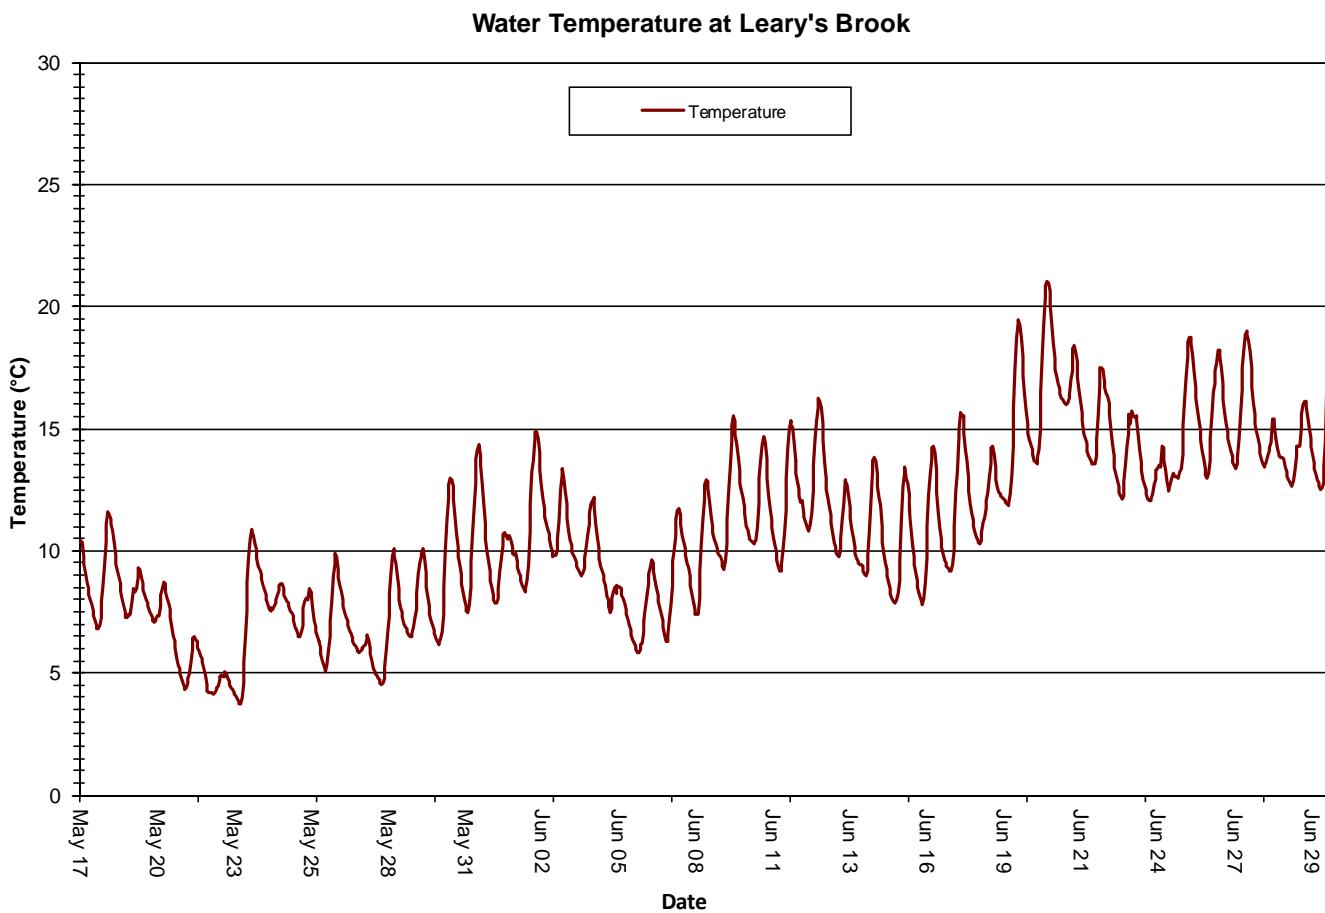


Figure 2: Water Temperature at Leary's Brook

pH

- Throughout this deployment period pH values ranged between 6.71 pH units and 7.19 pH units (Figure 3).
- The CCME guideline provides a basis by which to judge the overall health of the brook. Naturally, all streams and brooks are different. Leary's Brook pH median was 6.94 (pH units) for this deployment period.
- pH typically falls slightly in Leary's Brook (the water becomes more acidic) at the same time as stage and flow are increasing. In general, precipitation entering Leary's Brook has a lower pH than local surface water and this causes a reduction in the pH of the brook.

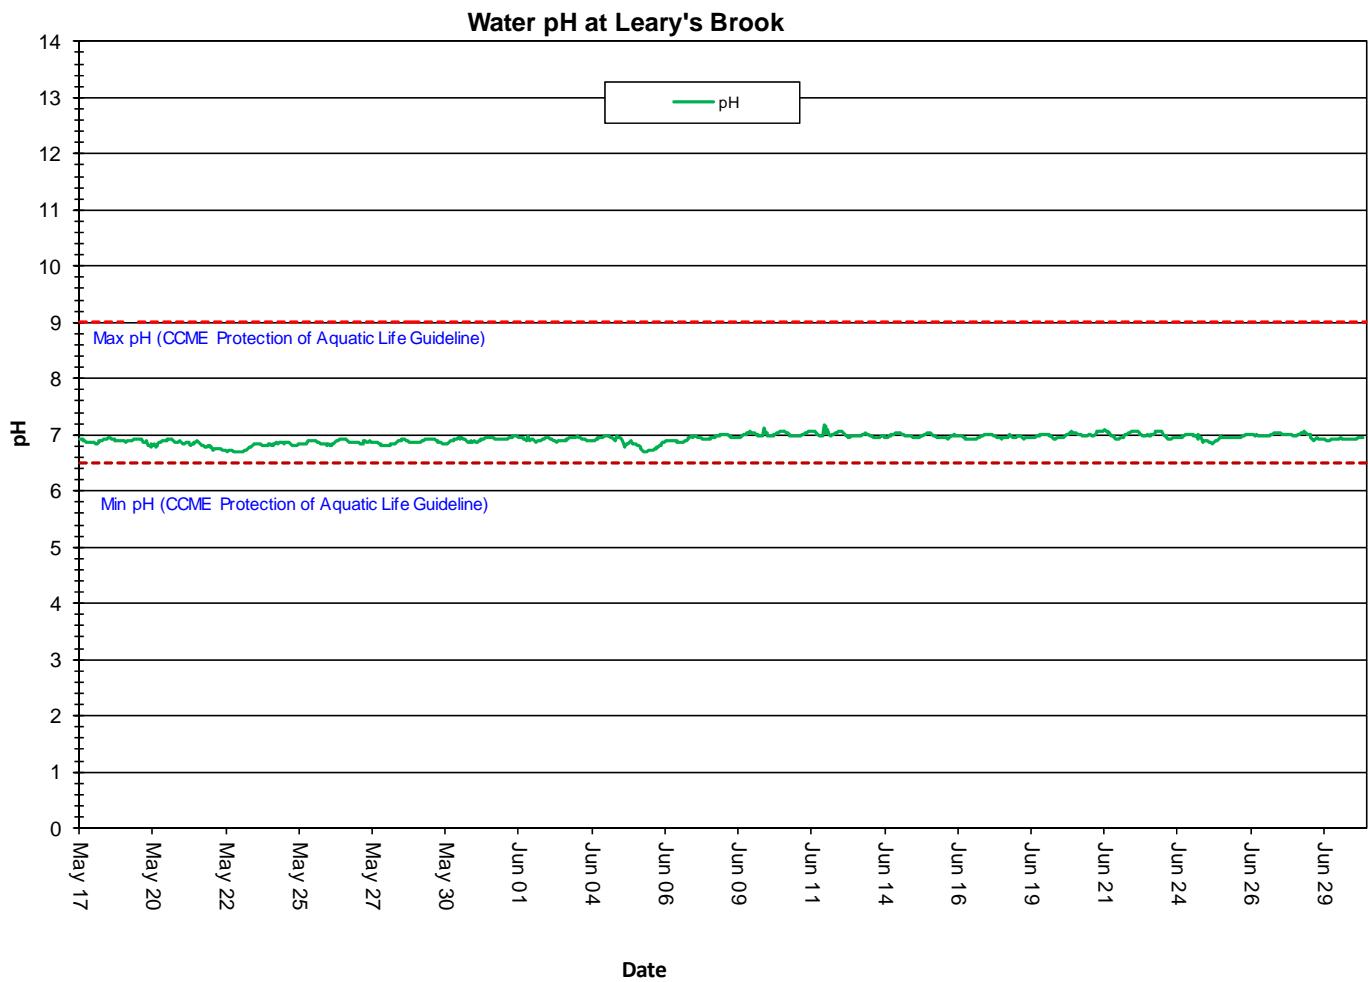


Figure 3: Water pH (pH units) values at Leary's Brook Station

Specific Conductivity

- The conductivity levels ranged between 222.0 $\mu\text{S}/\text{cm}$ and 856.0 $\mu\text{S}/\text{cm}$ during this deployment period. The median was 659.0 $\mu\text{S}/\text{cm}$. TDS ranged from 0.100 g/ml to 0.500 g/ml. (Figure 4)
- Decreases in conductivity seen during this deployment period are associated with precipitation runoff and increasing flows. This is typical for this time of the year as runoff from precipitation dilutes salts carried into the brook from urban environments.

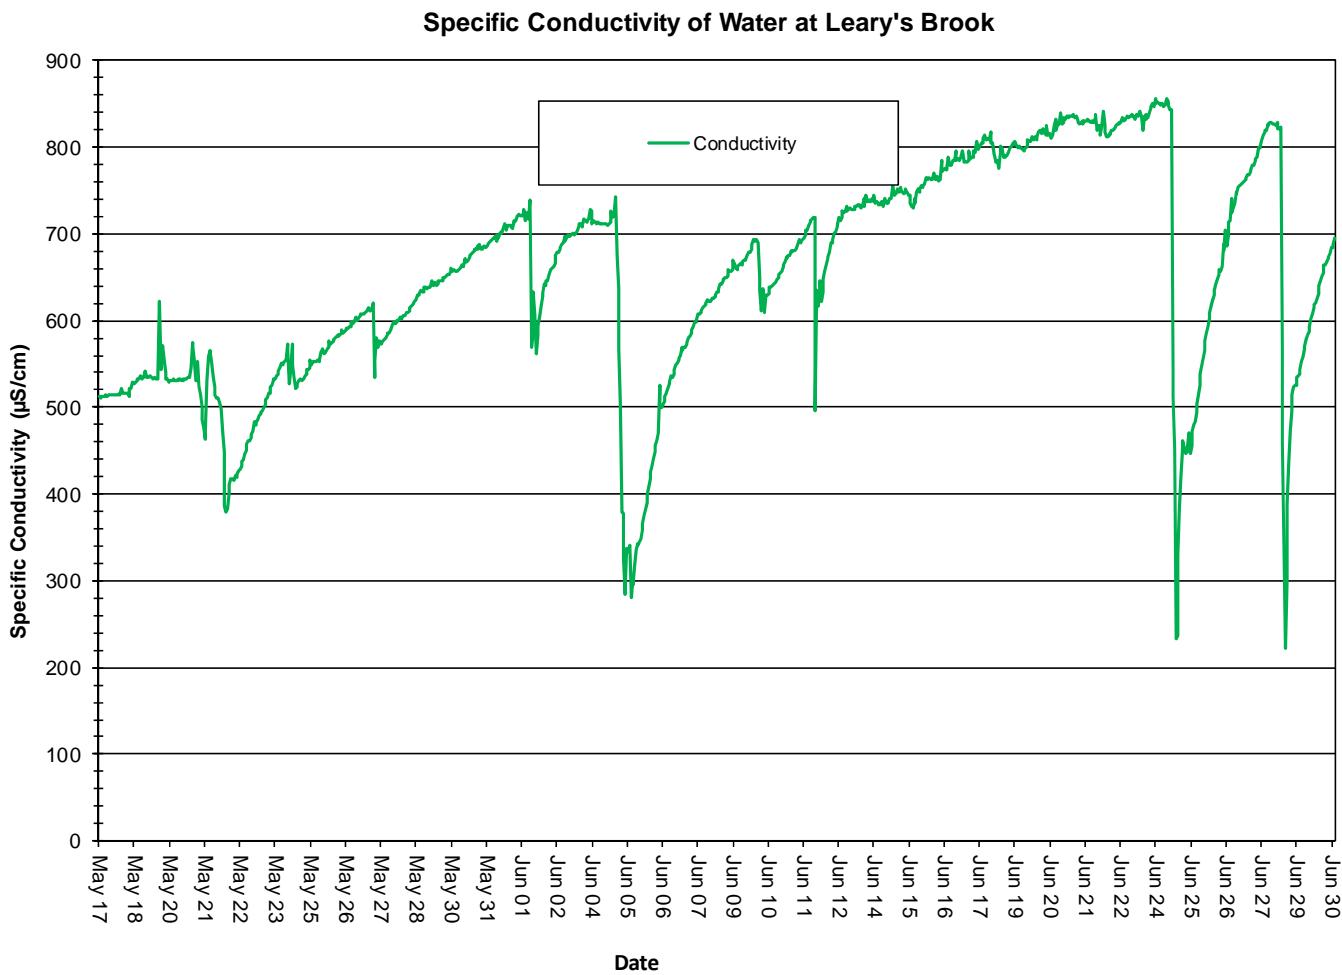


Figure 4: Specific conductivity values at Leary's Brook Station

Dissolved Oxygen

- The instrument measures dissolved oxygen (mg/L) and then calculates the percent saturation (% Sat.).
- The Dissolved Oxygen % Sat levels within this deployment period were between 93.8 % Sat and 101.3 % Sat. Dissolved Oxygen (mg/L) measured between 8.53 mg/L and 13.23 mg/L. (Figure 5)
- The DO mg/L values were above the minimum DO CCME guideline for the protection of early life stages during most of this deployment period (Figure 5).
- Small dips in mg/L values are associated with increases in water temperature. Cool water can hold more dissolved oxygen than warmer water.
- The overall decrease in DO corresponds with an overall increase in water temperature over the deployment period, as spring advances.

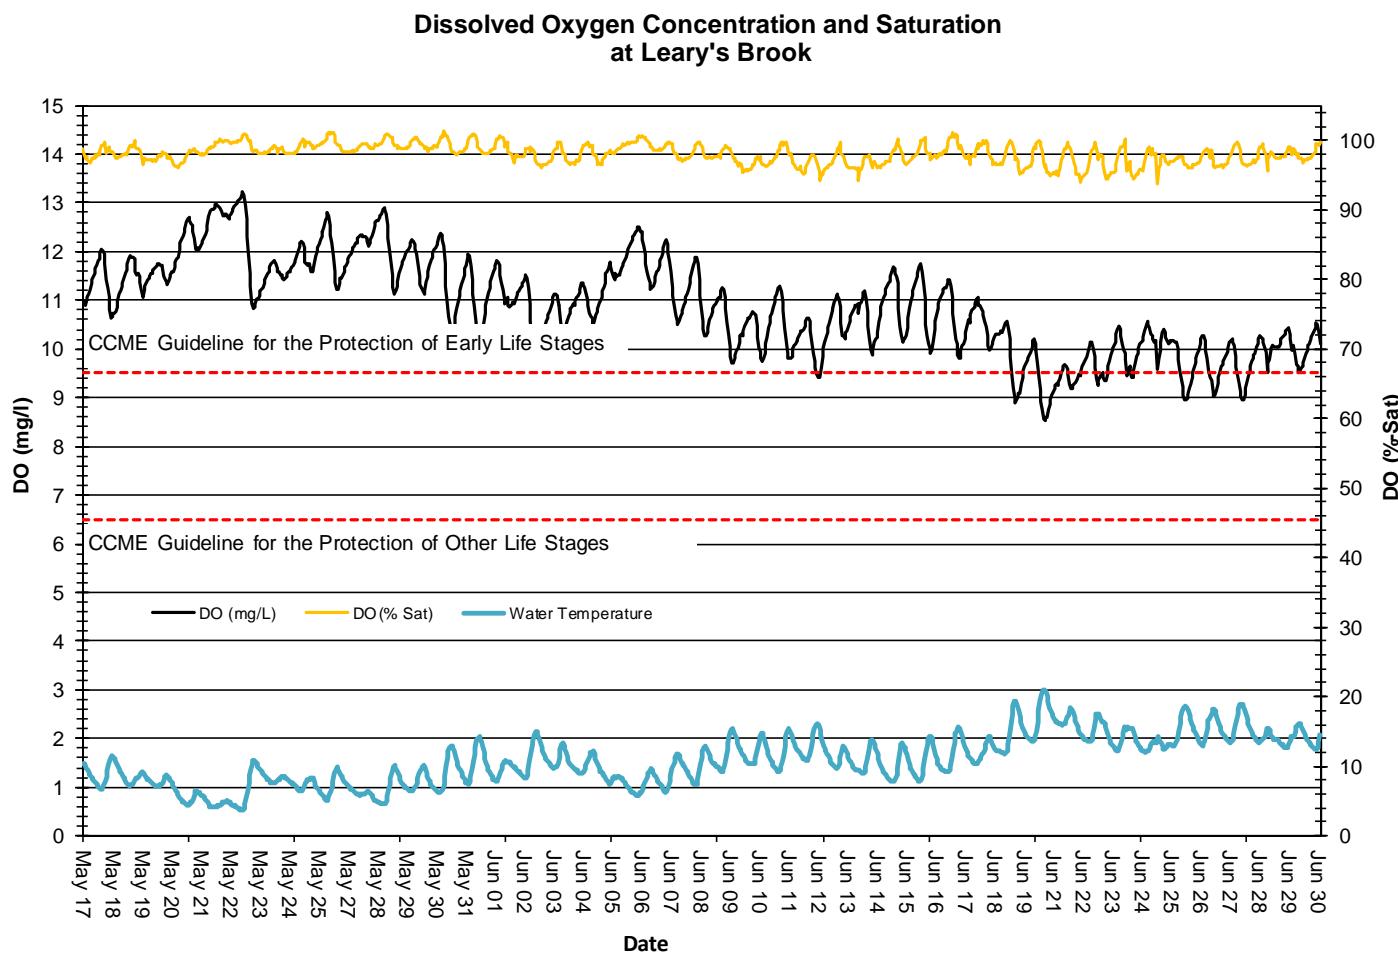


Figure 5: Dissolved oxygen (mg/L & % sat) and water temperature (°C) values at Leary's Brook Station

Turbidity

- The turbidity sensor records values between 0 NTU and 3000 NTU. A turbidity reading of 3000 NTU is identified as an error and is not a true value. Readings of 3000 NTU should not be included in any statistical analysis.
- The turbidity readings during this deployment ranged between 0.0 NTU to 220.3 NTU (Figure 6).
- Highest turbidity values usually correspond with the early stage of precipitation events and elevated river stage and runoff. Rainfall and subsequent runoff along with increased flow carries sediment and other material into the brook which is captured by the turbidity sensor. This is typical of Leary's Brook where significant sediment loading is associated with even minor precipitation events.


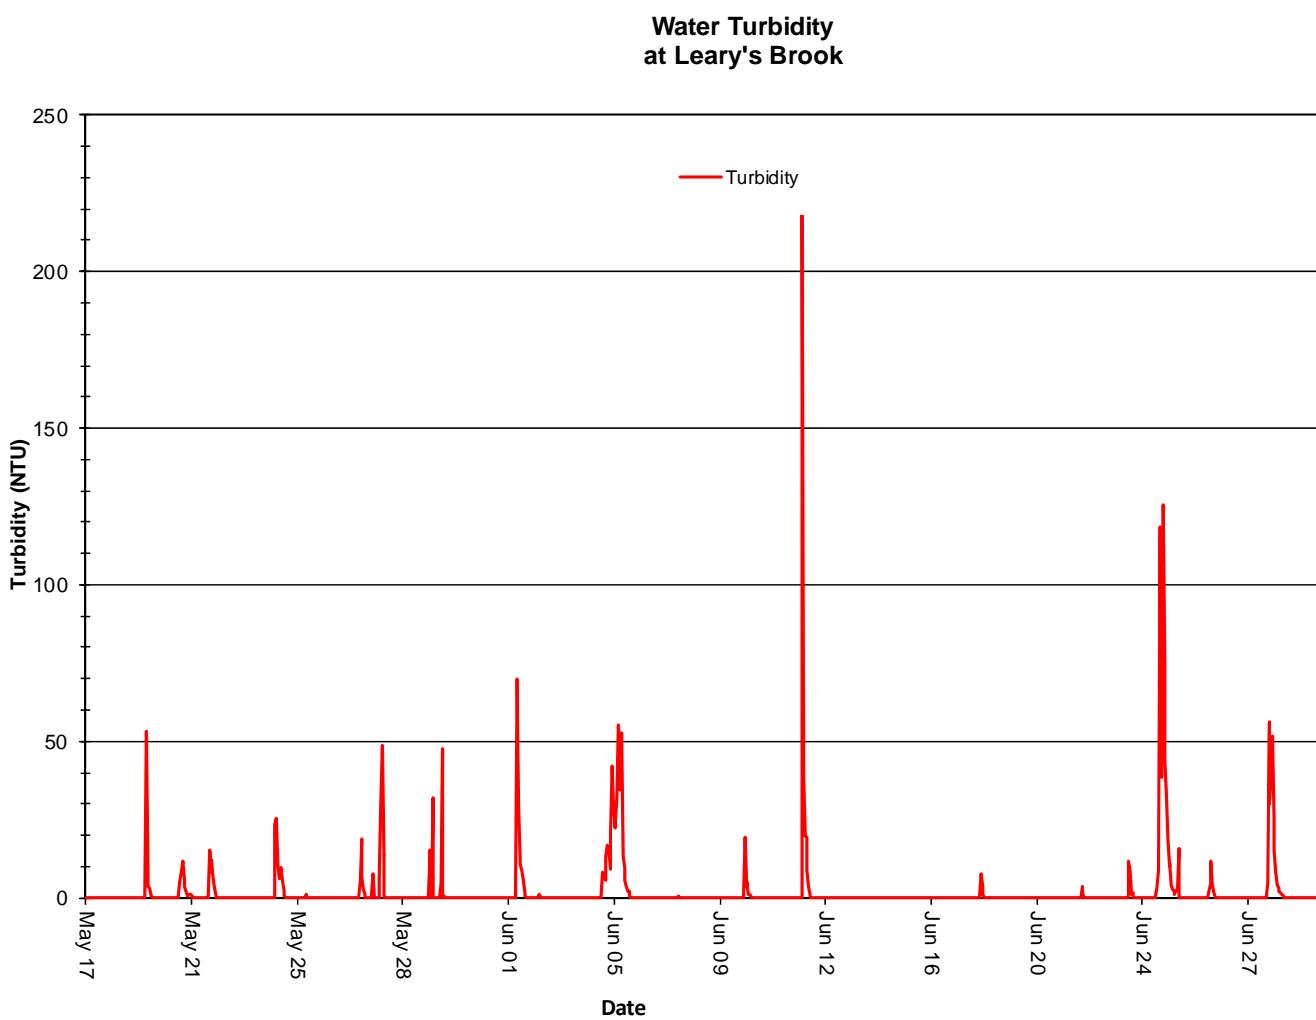


Figure 6: Turbidity (NTU) values at Leary's Brook Station

Stage and Flow

- The below graph includes stage and flow data that was generated by Water Survey of Canada (WSC) during this deployment period. Water Survey of Canada is responsible for QA/QC of water quantity data. Corrected and finalized data may be retrieved from the WSC website (<http://www.ec.gc.ca/rhc-wsc/>)

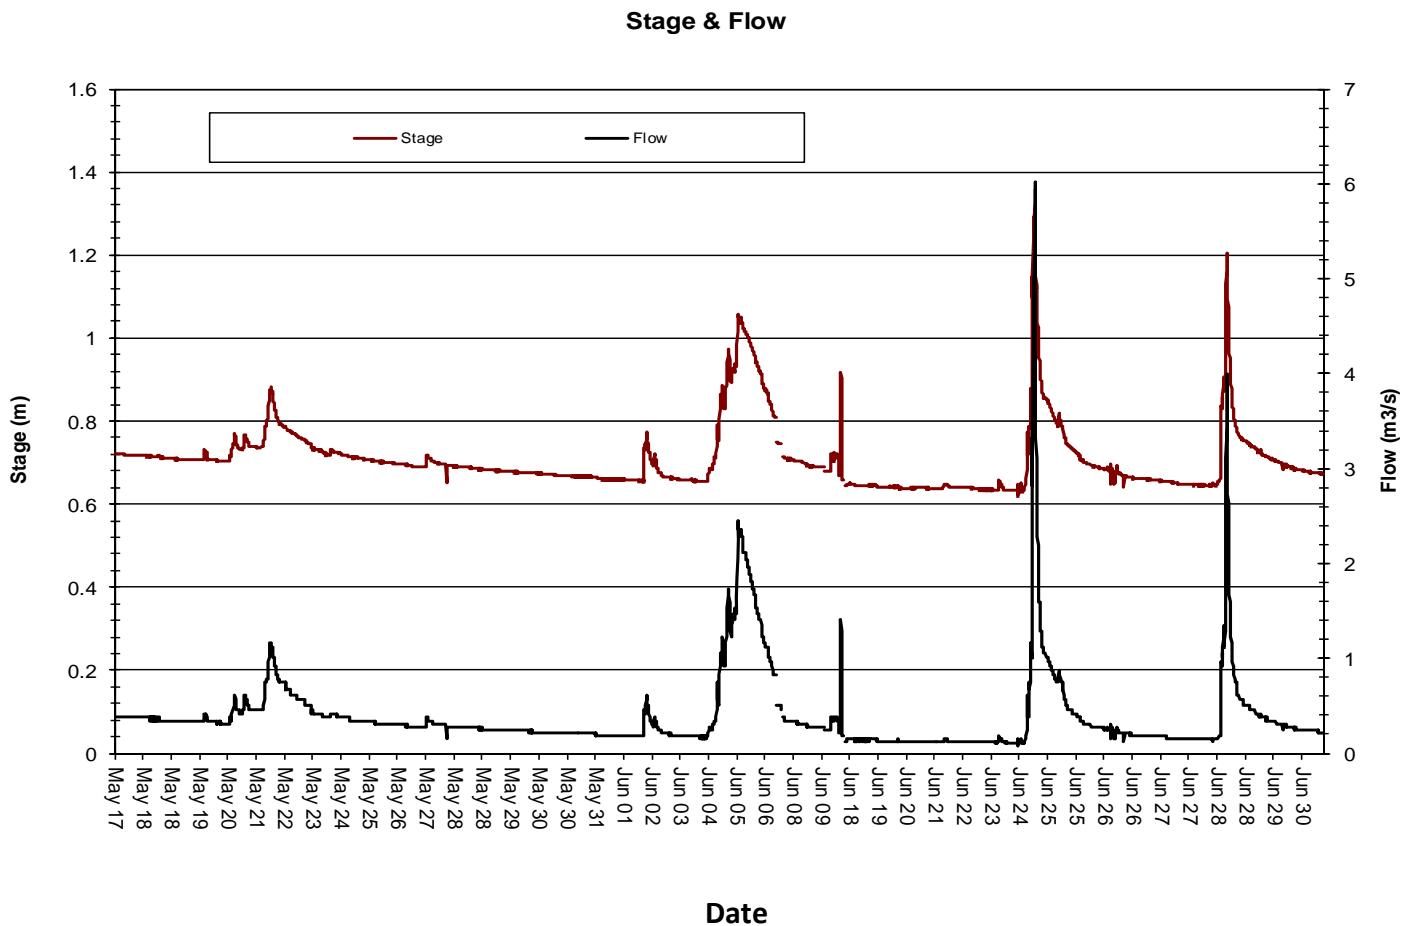

Stage and Total Precipitation

- The below graph includes daily total precipitation data from St. John's International Airport weather station and the daily average stage (Figure 7). Please note that the stage data in this report is raw data. It has not been corrected for backwater effect. WSC is responsible for QA/QC of water quantity data. Corrected data can be obtained upon request to WSC.
- Stage (and streamflow) usually varies significantly throughout a deployment period in Leary's Brook.

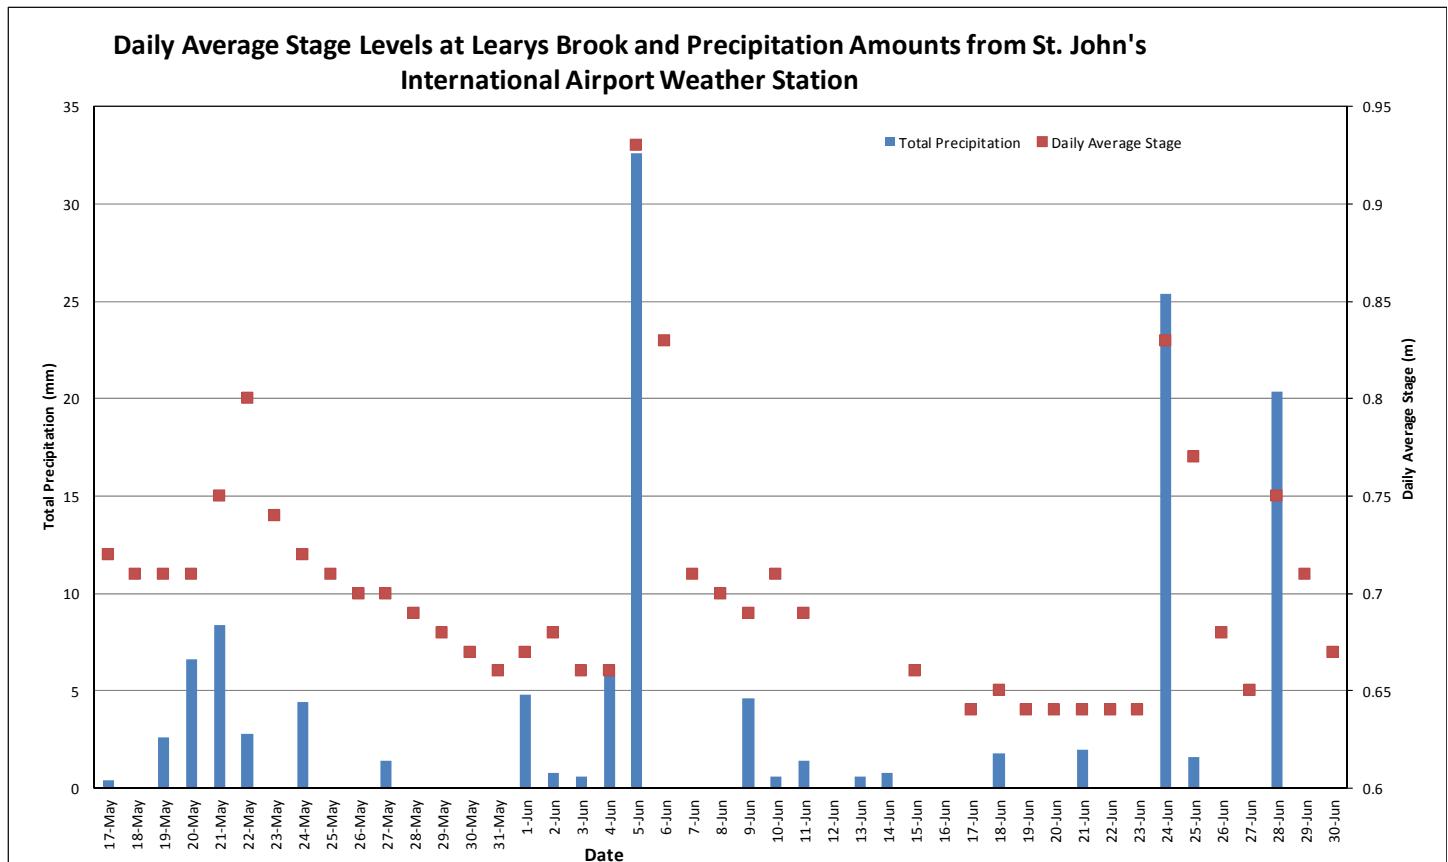


Figure 7: Daily average stage values (m) from Leary's Brook Station and daily total precipitation values (mm) from St. John's International Airport.

Conclusions

Generally in both natural and urban environments, climate and weather conditions can contribute in large part to variations in water quality. During this deployment it was evident that many of the changes in Leary's Brook water quality are related to intermittent precipitation events and small climatic changes of the seasons.

Precipitation and runoff events during the deployment period led to related increases in stage, which thus influenced the values of turbidity, pH, specific conductance, and TDS. Also, when ambient air temperatures increased there were correspondingly warmer water temperatures, which in turn decreased the amount of dissolved oxygen in the water.

During this deployment period the median water temperature at the Leary's Brook station was 10.4°C.

The median pH value for Leary's Brook Station was 6.94 (pH units). The pH level for the most part, falls at this station during rainfall events and increases during dry periods.

Conductivity had a median value of 659.0 $\mu\text{S}/\text{cm}$. The maximum conductivity was 856.0 $\mu\text{S}/\text{cm}$. At this time of year, conductivity increases in Leary's Brook as water levels decline and dissolved salts become more concentrated.

Dissolved Oxygen at Leary's Brook had a median of 98.1 %Sat and 10.88 mg/L during the deployment period. Small reductions in DO (mg/L and % Sat) correspond with increases in water temperatures.

The turbidity median value at Leary's Brook during deployment was 0.0 NTU. Increases in stage level can explain most, though not all, of the peaks in the turbidity values during the deployment period. As organic matter and sediments are washed into the brook, the suspended matter in the water column will increase and the turbidity sensor will detect an increase in water cloudiness. Turbidity values may also peak due to upstream construction activity or some other disturbance.